

## LAYING INSTRUCTION

Before filling the joints;

- 1) Make sure that the joints/cracks are free from dust and moisture.
- 2) If a foam strip is used, place this into the joint/cracks. The strip must be 2 mm thicker than the joint/crack width. While using rubber strip see below.
- 3) Apply the Linoprimer with a small paintbrush that fits into the joint/crack. 1 litre should cover approx 200 meter, based on width 4mm and depth of 20 mm.
- 4) Let the Linoprimer dry minimum 4 hours (at + 20C°)



Filling the joints/cracks;

- 1) Mix the Base (0,7 kg) with the hardener (0,3 kg) using a drilling machine. Make sure that you empty everything in the can with hardener!
- 2) Mix the base plus hardener for minimum 3 minutes.
- 3) Put the spout on the empty cartridge, fill the mixed Linofog materia I into the empty cartridge and put the lid on.
- 4) Place the filled cartridge into the cartridge pistol and cut the top of the spout to a suitable size (similar to the joint width).
- 5) Fill the joints or cracks. 1 kg (0,7+0,3 kg) should cover approx 15-17 meters, based on the width of 4 mm and depth of 20 mm.
- 6) Let it dry for at least 15-24 hours.
- 7) Grind the surface with fine sandpaper to a smooth level.

Protection during application;

Dangerous! Ensure good ventilation. Protect face, eyes and hands. Keep away from children.

*AB Lindec endeavours to provide correct information about technical properties and handling of its products. However, while AB Lindec has no control over the way in which the products are mixed and laid, or the conditions under which they set, AB Lindec can in no way be held responsible. AB Lindec is only responsible for the quality of the products at the time of delivery.*

While using rubber strip

